

# FC Impedance Meter KFM2030

Measurement of fuel cell impedance characteristics using AC impedance measurement Capability to measure cells of up to 20 V in the range of 10 mHz to 10 kHz Two constant current mode ranges - 30 A and 5 A - supported as the load rating Load current setting resolutions of 1 mA (30 A range) and 0.1 mA (5 A range) with maximum power consumption of 60 W Various protection functions Equipped with GPIB, RS-232C and USB interfaces as standard



# Fuel cell characteristic, variation, and service life testing can be done with ease!



# 

• Application software included

The impedance meter KFM2030 is intended to enable the impedance characteristics of a fuel cell to be measured easily through the use of the AC impedance measurement method. Using the application software that comes with it, the meter can obtain impedance values at different frequencies by means of AC impedance measurement and display the obtained values in a Cole-Cole plot. With a low-power DC load (60 W) built in it, KFM2030 supports fuel cell load testing at up to 20 V, at up to 30 A.

- Impedance of cells of up to 20V can be measured in the range of 10 mHz to 10 kHz. (The cell voltage can be read back as well in the 0 V-20 V range.)
- Two constant current modes ranges for the load rating: 30 A and 5 A Load current setting resolutions of 1 mA (30 A range) and 0.1 mA (5 A range) are available, with maximum power consumption of 60 W.
- Undervoltage protection, overvoltage protection, overpower protection, overheat protection, overcurrent protection, and line cut detection are supported.
- The backlit LCD offers enhanced visibility.
- Four types of measurement value can be chosen for display freely from R, X, |Z|, θ, V, and I.
- Equipped with GPIB, RS-232C and USB interfaces as standard.
- Impedance measurements can be made in the range of 10 mHz to 10 kHz as well on both primary and secondary cells.

# FC Impedance Meter KFM2030



# Why is impedance measurement necessary?

Not only fuel cells but also many other types of cells do not allow performance adjustment in the post-manufacturing stages. It is nonetheless necessary to run and test the cells in order to verify that they provide the expected levels of performance and meet the required specifications. However, running every manufactured cell for testing purposes is by no means easy. One way to examine the characteristics of individual cells in a short time is to conduct accurate impedance measurement.

Knowing impedance characteristics provides clues as to the characteristics and performance variation of cells as well as their service life.



# **Application software**

# Cole-Cole plot

ears ( ) ( ) (	Transmitti		
14-94 1 141 Instruction (1	The Disease B: 1 T 200	Gene 1	OFF
	Aug. [4.0] - 20.000	manhan	End
	the state		
	Manage and Desci		
and insulate the second lines	the first	April (22)	
C Descriptions	the later	1 Daniel	10.001 (94)
UNITABLE CUT IN		104411	
		destinated	
Contraction of the local division of the loc		Tarren .	to Dia protect
Carl and and	명령 변경 방송) 학원 명령	San D.	No inter
41.25			
has 1000 at as 11 at 1ml	11 12 12 12 12 12 12		
10.000.	Entry I want	- nerhalt	
Fin prima	A tran		In the second
- 10ml		- Carl	and in the state of
-1447 PE	10.1 0.1 0.1 0.1 0.1	1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1	to be a located
No. New			

▲Cole-Cole plot test screen

## Impedance measurement method - AC impedance measurement

There are several impedance measurement methods, including:


(1) AC impedance measurement, (2) current interrupt method, (3) fast Fourier transform, (4) litharge method, (5) impedance bridging, and (6) oscilloscope measurement.

Of these, AC impedance measurement is the most popular method. To measure large currents, the current interrupt method has been the technique of choice. This method, however, is often problematic in terms of data reproducibility and accuracy.

The AC impedance measurement method applies alternate current-induced vibration to the device under test (fuel cell), calculates the complex impedance from the amplitude of the resulting voltage and current and the phase difference, and then plots the impedance in a complex coordinate system. By varying the vibration frequency of alternate current, the method obtains the equivalent impedance from the plotted trajectory.

• Constants of the approximate equivalent circuit of the fuel cell are determined by the data obtained through multiple-point plotting of frequency (3 to 70 points).

# Current-voltage characteristic measurement testing (I-V characteristics)

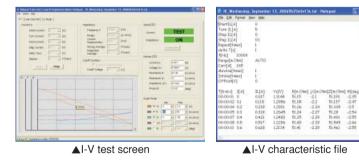


• The cell voltage and internal resistance are measured with respect to the load current, and a Tafel plot is displayed.

The quantity of gas flow is made constant, thus rendering it possible to conduct cell evaluation and to measure the current density based on the reaction area.

• The maximum resolution can be adjusted in 1 mA steps in the range of 0 A to 30 A. The software reads voltages with the specified resolution. The measurement can be repeated any number of times including infinitely.

# CC mode testing (for aging)

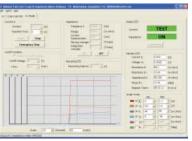

• The rise and fall times can be set to a maximum of 999 seconds each.

- The logging interval can be adjusted in the range of 1 to 99999 seconds.
- The measurement current can be applied continuously on a single frequency, thereby making it possible to measure load current impedances as high as 30 A.

(It is also possible to cut off the measurement alternate current.)

▲CC mode test screen

# KFM2030 specifications

Impedance measureme	ent part
Measurement frequency Frequency resolution	10 mHz to 10 kHz 14 points/decade - 1.00, 1.26, 1.58, 2.00, 2.51, 3.00, 3.16, 4.00, 5.00, 6.00, 6.30, 7.00, 8.00, 9.00
Measurement range*1	165 mA range (60 mA AC rms): 30 mΩ, 100 mΩ, 300 mΩ, AUTO 500 mA range (180 mA AC rms): 10 mΩ, 30 mΩ, 100 mΩ, AUTO
Measurement alternate current	60 mA rms (165 mA range), 180 mA rms (500 mA range), OFF
Measurement resolution	10 m $\Omega$ range: 1 $\mu\Omega$
	30 mΩ, 100 mΩ range: 10 $\mu$ Ω
	300 m $\Omega$ range: 100 $\mu\Omega$
Measurement value display	Four types of measurement value can be chosen for
	display freely from R, X, $ Z $ , $\theta$ , voltage, and current.
Measurement accuracy	10 mHz to 900 Hz R, X: ±2% of range*2
	1 kHz to 4 kHz R, X: ±3% of range*2
	5 kHz to 10 kHz R, X: ±4% of range*2
	, 5
DC voltage/current mea	asurement part
	asurement part Automatic switch between two ranges: 2 V and 20 V
	Automatic switch between two ranges: 2 V and 20 V
Voltage range Voltage measurement resolution	. Automatic switch between two ranges: 2 V and 20 V 2 V range: 100 $\mu$ V 20 V range: 1 mV
Voltage range Voltage measurement resolution	Automatic switch between two ranges: 2 V and 20 V 2 V range: 100 μV 20 V range: 1 mV 2 V range ±(0.2% of rdg* <sup>3</sup> + 6 digits)
Voltage range Voltage measurement resolution Voltage measurement accuracy	Automatic switch between two ranges: 2 V and 20 V 2 V range: 100 μV 20 V range: 1 mV 2 V range ±(0.2% of rdg* <sup>3</sup> + 6 digits) 20 V range ±(0.7% of rdg* <sup>3</sup> + 8 digits)
Voltage range Voltage measurement resolution Voltage measurement accuracy Current measurement resolution	Automatic switch between two ranges: 2 V and 20 V 2 V range: 100 μV 20 V range: 1 mV 2 V range ±(0.2% of rdg <sup>*3</sup> + 6 digits) 20 V range ±(0.7% of rdg <sup>*3</sup> + 8 digits) 1 mA
Voltage range Voltage measurement resolution Voltage measurement accuracy Current measurement resolution Current measurement accuracy	Automatic switch between two ranges: 2 V and 20 V 2 V range: 100 μV 20 V range: 1 mV 2 V range ±(0.2% of rdg* <sup>3</sup> + 6 digits) 20 V range ±(0.7% of rdg* <sup>3</sup> + 8 digits) 1 mA ±2% for 30 A
Voltage range Voltage measurement resolution Voltage measurement accuracy Current measurement resolution Current measurement accuracy Monitor output	Automatic switch between two ranges: 2 V and 20 V 2 V range: 100 µV 20 V range: 1 mV 2 V range ±(0.2% of rdg <sup>*3</sup> + 6 digits) 20 V range ±(0.7% of rdg <sup>*3</sup> + 8 digits) 1 mA ±2% for 30 A Voltage monitor: Outputs 10 V for sensing input
Voltage range Voltage measurement resolution Voltage measurement accuracy Current measurement resolution Current measurement accuracy	. Automatic switch between two ranges: 2 V and 20 V 2 V range: 100 μV 20 V range: 1 mV 2 V range ±(0.2% of rdg*3 + 6 digits) 20 V range ±(0.7% of rdg*3 + 8 digits) 1 mA ±2% for 30 A Voltage monitor: Outputs 10 V for sensing input voltage of 20 V.
Voltage range Voltage measurement resolution Voltage measurement accuracy Current measurement resolution Current measurement accuracy Monitor output	. Automatic switch between two ranges: 2 V and 20 V 2 V range: 100 μV 20 V range: 1 mV 2 V range ±(0.2% of rdg* <sup>3</sup> + 6 digits) 20 V range ±(0.7% of rdg* <sup>3</sup> + 8 digits) 1 mA ±2% for 30 A Voltage monitor: Outputs 10 V for sensing input voltage of 20 V. Voltage monitor accuracy: ±0.05 V
Voltage range Voltage measurement resolution Voltage measurement accuracy Current measurement resolution Current measurement accuracy Monitor output	Automatic switch between two ranges: 2 V and 20 V   2 V range: 100 μV   20 V range: 1 mV   2 V range ±(0.2% of rdg* <sup>3</sup> + 6 digits)   20 V range ±(0.7% of rdg* <sup>3</sup> + 8 digits)   1 mA   ±2% for 30 A   Voltage monitor: Outputs 10 V for sensing input voltage of 20 V.   Voltage monitor: Outputs 10 V for load current of 30 A.
Voltage range Voltage measurement resolution Voltage measurement accuracy Current measurement resolution Current measurement accuracy Monitor output	. Automatic switch between two ranges: 2 V and 20 V 2 V range: 100 μV 20 V range: 1 mV 2 V range ±(0.2% of rdg* <sup>3</sup> + 6 digits) 20 V range ±(0.7% of rdg* <sup>3</sup> + 8 digits) 1 mA ±2% for 30 A Voltage monitor: Outputs 10 V for sensing input voltage of 20 V. Voltage monitor accuracy: ±0.05 V

### Electronic load Operation mode..... Constant current Range... ..... Two ranges - 5 A and 30 A Maximum load current ...... 30 A Input voltage range.....0 V to 20 V Maximum input power ...... 60 W Current setting accuracy ...... ±(0.5% of set\*4 +10 mA) 30 A range: 0 A to 30 A for 0 V to 10 V

## Display

240 dots × 64 dots LCD with cold-cathode ray tube backlighting Impedance measurement part... 10 m $\Omega \rightarrow XX.XXX$  m $\Omega$ , 30 m $\Omega$ /100 m $\Omega \rightarrow XXX.XX$  m $\Omega$  $300 \text{ m}\Omega \rightarrow XXX.X \text{ m}\Omega$ 


DC voltage measurement part ... 0.0000 V to 2.0000 V and 2.000 V to 20.000 V

# Rear panel



## [Dimensions]

MA 10



# 

**KIKUSUI ELECTRONICS CORPORATION** 

1-1-3, Higashiyamata, Tsuzuki-ku, Yokohama, 224-0023, Japan

Phone: (+81) 45-593-7570, Facsimile: (+81) 45-593-7571, www.kikusui.co.jp



KIKUSUI AMERICA, INC.1-877-876-2807 www.kikusuiamerica.com 1633 Bayshore Highway, Suite 331, Burlingame, CA 94010 Phone : 650-259-5900 Facsimile : 650-259-5904

### KIKUSUI TRADING (SHANGHAI) Co., Ltd. www.kikusui.cn Room, D-01,11F, Majesty Bld, No.138, Pudong Ave, Shanghai City 🕼 KIKUSUI Phone: 021-5887-9067 Facsimile: 021-5887-9069

### External control interface GPIB, RS-232C, and USB Average setting The integral average (1 to 32) and the moving average (1 to 256) may be used in combination. Protection functions Overvoltage protection (OVP) ... The load is cut off if a voltage of 21 volts or higher is applied to the sensing terminal. Overpower protection (OPP). Power of 63 watts or higher activates the CP and lights the OVER LOAD LED lamp. Overheat protection (OHP) ... The load is cut off if the temperature inside the load unit becomes abnormally high. Overcurrent protection (OCP) . If a load current of 31.5 amperes or higher flows, the LCD displays "ALM:OCP" and the load is cut off. Undervoltage protection (UVP) ... The load is cut off if the voltage applied to the sensing terminal falls below the set voltage limit. This voltage limit can be set in the range of -2 V to 20 V. **General specifications** External control

External control	
Input CC control, LOAD ON/OFF, load range: 0/5 V	
Output V monitor, I monitor, alarms, load status	
Environment	
Warm-up time	
Installation altitude 2000 m or below	
Storage temperature and10°C to +60°C, 90% rh or below	
humidity range (no dew condensation allowed)	
Operating temperature and 0°C to +40°C, 20% to 85% rh or below	
humidity range (no dew condensation allowed)	
Guaranteed temperature +15°C to +35°C, 20% to 85% rh or below	
and humidity range (no dew condensation allowed)	
Power	
Allowable power voltage range 90 VAC to 132 VAC, 180 VAC to 250 VAC	
Power frequency range 45 Hz to 65 Hz	
Maximum power consumption 600 VA or less	
Dielectric resistance	
Withstand voltage	
Dimensions (maximum) 430 (455) W × 88 (105) H × 380 (450) D mm	
Weight Approx. 9.5 kg	

## Accessories


Power cord: 1 Sensing line: 1

Load line: 1 Operation manual: 1 Application software (CD): 1

### Options

KRB100-TOS (JIS) Rack mount bracket ..... KRB2-TOS (EIA)

- Values up to four times the range can be measured. Note that, in cases where the drift or ripple of the fuel cell is large or there is much noise, a value lower than the range may be regarded as exceeding the range.
- range: Measurement range
- \*3 rdg: Reading of input voltage
- set: Value set for input current The set full scale can be fine-tuned





Distributor:

All products contained in this catalogue are equipment and devices that are premised on use under the supervision of qualified personnel, and are not designed or produced for home-use or use by general consumers. ■ Specifications, design and so forth are subject to change without prior notice to improve the quality. ■ Product names and prices are subject to change and production may be discontinued when necessary. ■ Product names, company names and brand names contained in this catalogue represent the respective registered trade name or trade mark. ■ Colors, textures and so forth of photographs shown in this catalogue may differ from actual products due to a limited fidelity in printing. Although every effort has been made to provide the information as accurate as possible for this catalogue, certain details have unavoidably been omitted due to limitations in space. If I you find any misprints or errors in this catalogue, price it would be appreciated if you would inform us. I Please contact our distributors to confirm specifications, price, accessories or anything that may be unclear when placing an order or concluding a purchasing agreement

Printed in Japan